### PROFORMA INVOICE

Invoice No. Dated Vastukala Consultants (I) Pvt Ltd B1-001,U/B FLOOR, PG-2664/23-24 27-Sep-23 BOOMERANG, CHANDIVALI FARM ROAD, Delivery Note Mode/Terms of Payment ANDHERI-EAST 400072 **AGAINST REPORT** GSTIN/UIN: 27AADCV4303R1ZX Reference No. & Date. Other References State Name: Maharashtra, Code: 27 E-Mail: accounts@vastukala.org Buyer's Order No. Dated Buyer (Bill to) DILIP KASHINATH SANKHE Delivery Note Date Dispatch Doc No. Residential Flat No. 301, 3rd Floor, Wing - B, "Devikrupa Co-Op. Hsg. Soc. Ltd.", 004066/2302746 R.J. Nagar, Phoolpada Road, Virar (East), Dispatched through Destination Palghar - 401 305, State Name : Maharashtra, Code: 27 Terms of Delivery SI **Particulars** HSN/SAC GST Amount No. Rate 1 STRUCTURAL REPORT FEE 997224 18 % 1.500.00 (Technical Inspection and Certification Services) CGST 135.00 SGST 135.00 Total 1,770.00 E. & O.E Amount Chargeable (in words) Indian Rupee One Thousand Seven Hundred Seventy Only HSN/SAC Taxable Central Tax State Tax Total Rate Value Rate Amount Amount Tax Amount 1,500,00 135,00 135,00 270.00 997224 9% Total 1,500.00 135.00 135.00 270.00 Tax Amount (in words) : Indian Rupee Two Hundred Seventy Only Company's Bank Details Bank Name The Cosmos Co-Operative Bank Ltd A/c No. 0171001022668 Branch & IFS Code: Vileparte & COSB0000017 Remarks: Mr. Dilip Kashinath Sankhe - Structural Observation Report of Residential Flat No. 301, 3rd Floor, Wing -B, "Devikrupa Co-Op. Hsg. Soc. Ltd.", R.J. Nagar, Phoolpada Road, Virar (East), Palghar - 401 305, State - Maharashtra, Country - India Company's PAN : AADCV4303R \*17,44 UPI Virtual ID : Vastukala@icici Declaration NOTE - AS PER MSME RULES INVOICE NEED TO for Vastukala Consultants (I) Pvt Ltd BE CLEARED WITHIN 45 DAYS OR INTEREST Asmita Rathod CHARGES APPLICABLE AS PER THE RULE.

This is a Computer Generated Invoice

MSME Registration No. - 27222201137





Authorised Signatory

CIN: U74120MH2010PTC207869 MSME Reg. No.: UDYAM-MH-18-0083617 An ISO 9001:2015 Certified Company





Structural Stability Report Prepared For: Cosmos Bank / Vasai (West) Branch / Mr. Dilip Kashinath Sankhe (4066/2302746)

Done tof

Vastu/Mumbai/09/2023/4066/2302746 27/14-390-PRSH Date: 27 09.2023

## Structural Stability Report

Structural Observation Report of Residential Flat No. 301, 3rd Floor, Wing – B, "Devikrupa Co-Op. Hsg. Soc. Ltd.", R.J. Nagar, Phoolpada Road, Virar (East), Palghar – 401 305, State – Maharashtra, Country – India.

## Name of Owner: Mr. Dilip Kashinath Sankhe

This is to certify that on visual inspection, it appears that the structure of the Wing – B at " Devikrupa Co-Op. Hsg. Soc. Ltd.", is in good condition and the future life can be reasonably takes under good condition and with proper periodic repairs & maintenance is about 39 years.

General Information:

A.		Introduction
1	Name of Building	"Devikrupa Co-Op, Hsg. Soc. Ltd."
2	Property Address	Flat No. 301, 3rd Floor, Wing – B, "Devikrupa Co-Op. Hsg.
		Soc. Ltd.", R.J. Nagar, Phoolpada Road, Virar (East),
	W. :	Palghar – 401 305, State – Maharashtra, Country – India.
3	Type of Building	Residential used
4	No. of Floors	Ground + 3 Upper Floors
5	Whether stilt / podium / open parking	Open Car Parking Space
	provided	
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	2002 (As per Part Occupancy Certificate)
11	Present age of building	21 years 21 20 2
12	Residual age of the building	39 years Subject to proper, preventive periodic
		maintenance & structural repairs.
13	No. of flats (Per Floor)	4 Flats оп 3 <sup>rd</sup> Floor
14	Methodology adopted	As per visual site inspection
	• • •	





Our Pan India Presence at:

Mumbai P. Aurangabad P. Pune P. Rajkot
Thane P. Manded P. In dore P. Reipur
Delhi NCR P. Nurshik P. Ahmedabod P. Jaipur

Regd. Office: B1-001, U/B Floor, Boomerang, Chandivali Farm Road, Andheri (East), Mumbai: 400 072, (M.S.), INDIA

TeleFax: +91 22 28371325/24 mumbai@vas.tukala.orgi

B.	External Observation of the Building	
1	Plaster	Good Condition
2	Chajjas	Good Condition
3	Plumbing	Good Condition
4	Cracks on the external walls	Not found
5	Filling cracks on the external walls	Not found
6	Cracks on columns & beams	Not found
7	Vegetation	Not found
8	Leakages of water in the drainage	Not found
	pipes or water pipes	
9	Dampness external in the wall due to	Not found
	leakages	
10	Any other observation about the	The external condition of the building is in good
	condition of external side of the	condition
	building	all and the second second
C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Good Condition
2	Columns (Cracks & Leakages)	Good Condition
3	Ceiling (Cracks & Leakages)	Good Condition
4	Leakages inside the property	Not found
5	Painting inside the property	Good
6	Maintenance of staircase & cracks	Good
D	Common Observation	
1	Structural Audit of the Building Under	As per bye Laws No. 77 of Co-Op. Societies bye Laws
	Bye - Laws No. 77 of the Model Bye	under the Act the society shall conduct a Structural

#### Ε Conclusion

Rules)

Remark

2

The captioned building is having Ground + 3 Upper Floors which are constructed in year 2002 as per Part Occupancy certificate. Estimated future life under present circumstances is about 39 years subject to proper, preventive periodic maintenance & structural repairs.

perusal.

The inspection dated 22.09.2023 reveals no structural damage or deterioration to the building. The building as well as the property is maintained in good condition & will stand future life subject to proper, preventive periodic maintenance & good structural repairs.

Our Observations about the structure are given above.

Laws (Co-Operative Societies Act /

The above assessment is based on visual inspection only.

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Sharadkumar § B. Chalikwar



## Director

Sharadkumar B. Chalikwar

Govt. Reg. Valuer Chartered Engineer (India)

Reg. No. (N) CCIT/1-14/52/2008-09

SBI Empanelment No.: SME/TCC/2021-22/85/13



Audit of the building of the society as follows

No Structural Audit Report is furnished for the



# Actual site photographs

















