### PROFORMA INVOICE

Invoice No. Dated Vastukala Consultants (I) Pvt Ltd PG-3808/23-24 15-Dec-23 B1-001, U/B FLOOR, BOOMERANG, CHANDIVALI FARM ROAD, **Delivery Note** Mode/Terms of Payment ANDHERI-EAST 400072 AGAINST REPORT GSTIN/UIN: 27AADCV4303R1ZX Reference No. & Date. Other References State Name: Maharashtra, Code: 27 E-Mail: accounts@vastukala.org Buyer's Order No. Dated Buyer (Bill to) Ram Devsi Kambaria Dispatch Doc No. Delivery Note Date Residential Flat No. C-104, 1st Floor, 005642/2303990 C - Wing, "Kailash Bhavan Co-Op. Hsg. Soc. Ltd." Dispatched through Destination Off. Chulna Road, Diwanman, Vasai (West), 401202, State - Maharashtra, : Maharashtra, Code: 27 State Name Terms of Delivery **Particulars** HSN/SAC GST Amount SI Rate No. 1 997224 STRUCTURAL REPORT FEE 18 % 1,500.00 (Technical Inspection and Certification Services) **CGST** 135.00 SGST 135.00 Total 1,770.00 Amount Chargeable (in words) E. & O.Ē Indian Rupee One Thousand Seven Hundred Seventy Only HSN/SAC Taxable Central Tax State Tax Total Value Rate Amount Rate Amount Tax Amount 997224 1,500.00 9% 135.00 9% 135.00 270.00 Total 1,500.00 135.00 135.00 270.00 Tax Amount (in words): Indian Rupee Two Hundred Seventy Only Company's Bank Details : The Cosmos Co-Operative Bank Ltd Bank Name Remarks: A/c No. 0171001022668 005642/2303990 Shri. Ram Devsi Kambaria & Smt. Branch & IFS Code: Vileparle & COSB0000017 Vanita Ram Kambaria - Residential Flat No. C - 104, 1st Floor, C - Wing "Kailash Bhavan Co-Op. Hsg. Soc. Ltd." Off. Chulna Road, Diwanman, Vasai (West), 401202, State - Maharashtra, Country - India. Company's PAN : AADCV4303R Declaration NOTE - AS PER MSME RULES INVOICE NEED TO BE CLEARED WITHIN 45 DAYS OR INTEREST CHARGES APPLICABLE AS PER THE RULE. MSME Registration No. - 27222201137 UPI Virtual ID : Vastukala@icici

This is a Computer Generated Invoice

Customer's Seal and Signature





for Vastukala Consultants (I) Pvt Ltd

ASMITA JAYSING RATHOD

Authorised Signatory

CIN: U74120MH2010PTC207869 MSME Reg. No.: UDYAM-MH-18-0083617 An ISO 9001: 2015 Certified Company





Structural Stability Report Prepared For: Cosmos Bank / Vasai (West) Branch / Shri. Ram Devsi Kambaria (5642/2303990)

Page 1 of 4

Vastu/Mumbai/12/2023/5642/2303990 15/15-2129-KPSK Date: 15.12.2023

## **Structural Stability Report**

Structural Observation Report of Residential Flat No. C - 104, 1st Floor, C - Wing **"Kailash Bhavan Co-Op. Hsg. Soc. Ltd."** Off. Chulna Road, Diwanman, Vasai (West), 401202, State – Maharashtra, Country – India.

### Name of Owner: Shri. Ram Devsi Kambaria & Smt. Vanita Ram Kambaria

This is to certify that on visual inspection, it appears that the structure of the at "Kailash Bhavan Co-Op. Hsg. Soc. Ltd.", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 29 years.

#### **General Information:**

| A. |  | Introduction  |
|----|--|---|
| 1  | Name of Building                               | "Kailash Bhavan Co-Op. Hsg. Soc. Ltd."  |
| 2  | Property Address                               | Residential Flat No. C - 104, 1st Floor, C - Wing "Kailash Bhavan Co-Op. Hsg. Soc. Ltd." Off. Chulna Road, Diwanman, Vasai (West), 401202, State — Maharashtra, Country – India |
| 3  | Type of Building                               | Residential used  |
| 4  | No. of Floors                                  | Ground + 3 Upper Floors   |
| 5  | Whether stilt / podium / open parking provided | Open Provided   |
| 6  | Type of Construction                           | R.C.C. Framed Structure   |
| 7  | Type of Foundation                             | R.C.C. Footing  |
| 8  | Thickness of the External Walls                | 9" thick brick walls both sides plastered   |
| 9  | Type of Compound                               | Brick Masonry Walls   |
| 10 | Year of Construction                           | 1992 (As per Letter from Navghar Manickpur Council)   |
| 11 | Present age of building                        | 31 years  |
| 12 | Residual age of the building                   | 29 years Subject to proper, preventive periodic maintenance & structural repairs.   |
| 13 | No. of flats (Per Floor)                       | 4 Flats on 1st Floor  |
| 14 | Methodology adopted                            | As per visual site inspection   |

| B. | External Observation of the Building |           |                        |
|----|--------------------------------------|-----------|------------------------|
| 1  | Plaster                              | Not found |                        |
| 2  | Chajjas                              | Not found | CONSULTAN              |
| 3  | Plumbing                             | Not found |                        |
| 4  | Cracks on the external walls         | Not found |                        |
| 5  | Filling cracks on the external walls | Not found | TO MY 30 to P ( Pall 8 |
| 6  | Cracks on columns & beams            | Not found |                        |





Regd. Office: B1-001, U/B Floor, Boomerang, Chandivali Farm Road, Andheri (East), Mumbai - 400 072, (M.S.), INDIA

TeleFax : +91 22 28371325/24

mumbai@vastukala.org

| 7  | Vegetation  | Not found  |
|----|---|--|
| 8  | Leakages of water in the drainage pipes or water pipes                          | Not found  |
| 9  | Dampness external in the wall due to leakages                                   | Not found  |
| 10 | Any other observation about the condition of external side of the building      | <ol> <li>At the time of site inspection, external condition of<br/>the building is normal.</li> <li>Structural Stability Report from licensed structural<br/>engineers not provided for our verification.</li> </ol> |
| С  | Internal Observation of the common areas of the building and captioned premises |  |
| 1  | Beams (Cracks & Leakages)   | Not found  |
| 2  | Columns (Cracks & Leakages)   | Not found  |
| 3  | Ceiling (Cracks & Leakages)   | Not found (B)  |
| 4  | Leakages inside the property  | Not found ·  |
| 5  | Painting inside the property  | Good   |
| 6  | Maintenance of staircase & cracks   | Normal .   |

| D | Common Observation                         |  |
|---|--|--|
| 1 | Structural Audit of the Building Under Bye | As per bye Laws No. 77 of Co-Op. Societies bye Laws        |
|   | - Laws No. 77 of the Model Bye Laws        | under the Act the society shall conduct a Structural Audit |
|   | (Co-Operative Societies Act / Rules)       | of the building of the society as follows                  |
| 2 | Remark                                     | No Structural Audit Report is furnished for the perusal.   |
|   | 7.1  | Cracks found in beam and column at some locations.         |

#### E Conclusion

The captioned building is having Ground + 3 Upper Floors which are constructed in year 1992 as per Navghar Manickpur Council Letter Estimated future life under present circumstances is about 29 years subject to proper, preventive periodic maintenance & structural repairs.

The inspection dated 13.12.2023 reveals no structural damage or deterioration to the building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs.

Our Observations about the structure are given above.

The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Sharadkumar

B. Chalikwar

Digitally signed by Sharadkumar B.

DN: cn=Sharadkumar 8. Chalikwar, o=Vastukala Consultants (I) Pvr. Ltf., ou=CMD, email=cmd@vastukala.org, c Date: 2023.12.15 17:13:19 +05:20'

Auth. Sign

Director

Sharadkumar B. Chalikwar

Govt. Reg. Valuer Chartered Engineer (India)


Reg. No. (N) CCIT/1-14/52/2008-09

BOB Empanelment No.: ZO:MZ:ADV:46:941






# **Actual Site Photographs**

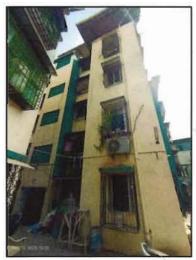



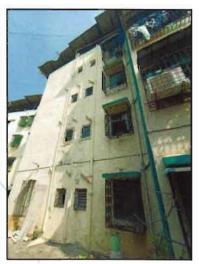












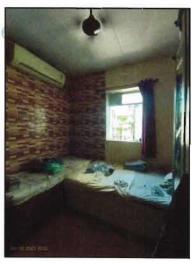

# **Actual Site Photographs**







Think.Innovate.Create

(1)



