

## Structural Stability Report

Structural Observation Report of Residential Flat No. 202, 2nd Floor, Wing - C, "**Gaurav Residency C Wing Co-op. Hsg. Soc. Ltd.**", Gaurav Residency Phase - 1, Near Mayor Bungalow, Next to Marigold, Beverly Park, Mira Road (East), Taluka - Thane, District - Thane, PIN - 401 107, State - Maharashtra, India.

Name of Owner: **Mr. Nitin Rameshchandra Mishra & Mr. Rameshchandra S. Mishra**

This is to certify that on visual inspection, it appears that the structure of the at "**Gaurav Residency C Wing Co-op. Hsg. Soc. Ltd.**", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 42 years.

### General Information:

A.	Introduction	
1	Name of Building	" <b>Gaurav Residency C Wing Co-op. Hsg. Soc. Ltd.</b> "
2	Property Address	Residential Flat No. 202, 2nd Floor, Wing - C, " <b>Gaurav Residency C Wing Co-op. Hsg. Soc. Ltd.</b> ", Gaurav Residency Phase - 1, Near Mayor Bungalow, Next to Marigold, Beverly Park, Mira Road (East), Taluka - Thane, District - Thane, PIN - 401 107, State - Maharashtra, India.
3	Type of Building	Residential used
4	No. of Floors	Ground + 7 Upper Floors
5	Whether stilt / podium / open parking provided	Open Car Parking Space
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	2006 (As per Part Occupancy Certificate)
11	Present age of building	18 years
12	Residual age of the building	42 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	04 Flats on 2 <sup>nd</sup> Floor
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition




### Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur

### Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai**: 400072, (M.S), India

 +91 2247495919

 [mumbai@vastukala.co.in](mailto:mumbai@vastukala.co.in)

 [www.vastukala.co.in](http://www.vastukala.co.in)



4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
<b>C</b>	<b>Internal Observation of the common areas of the building and captioned premises</b>	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Normal Condition
6	Maintenance of staircase & cracks	Good

<b>D</b>	<b>Common Observation</b>	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

<b>E</b>	<b>Conclusion</b>
<p>The captioned building is having Ground + 7 Upper Floors which are constructed in year 2006 (As per Part Occupancy Certificate). Estimated future life under present circumstances is about 42 years subject to proper, preventive periodic maintenance &amp; structural repairs.</p> <p>The inspection dated 18.04.2024 of building. The building is well as the property is maintained in normal condition &amp; will stand future life subject to proper, preventive periodic maintenance &amp; Good structural repairs.</p> <p>Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

**Sharadkumar B. Chalikwar**

Structural Engineer Licence No. STATE/R/2022/APL/01785

Govt. Reg. Valuer

Chartered Engineer (India)

Reg No. (N) CCIT/1-14/52/2008-09

SBI Empanelment No.: SME / TCC / 2021 – 22 / 85 / 13



Since 1989

**Vastukala Consultants (I) Pvt. Ltd.**

An ISO 9001 : 2015 Certified Company



## Actual site photographs





## Actual site photographs

