

Structural Stability Report

Structural Observation Report of Residential Flat No. 411, 4th Floor, Wing – C, "New Jain Darshan Co-op. Hsg. Soc. Ltd.", Cabin Cross Road, Village – Khari, Bhayander (East), Taluka & District – Thane, PIN Code – 401 105, State – Maharashtra, Country – India.

Name of Owner: **Smt. Kanchanbai J. Jain**

This is to certify that on visual inspection, it appears that the structure of the at "New Jain Darshan Co-op. Hsg. Soc. Ltd." is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 35 years.

General Information:

A.	Introduction	
1	Name of Building	New Jain Darshan Co-op. Hsg. Soc. Ltd.
2	Property Address	Residential Flat No. 411, 4 th Floor, Wing – C, "New Jain Darshan Co-op. Hsg. Soc. Ltd.", Cabin Cross Road, Village – Khari, Bhayander (East), Taluka & District – Thane, PIN Code – 401 105, State – Maharashtra, Country – India
3	Type of Building	Residential used
4	No. of Floors	Ground + 4 Upper Floor
5	Whether stilt / podium / open parking provided	Open Car Parking Space
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1999 (Approx.)
11	Present age of building	25 Years
12	Residual age of the building	35 years Subject to proper, preventive periodic maintenance & structural repairs
13	No. of flats (Per Floor)	4 Flats on 4 th Floor
14	Methodology adopted	As per visual site inspection




Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur

Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai**: 400072, (M.S), India

 +91 2247495919

 mumbai@vastukala.co.in

 www.vastukala.co.in



B.	External Observation of the Building	
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition
4	Cracks on the external walls	Minor cracks were found at some places
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Found
10	Any other observation about the condition of external side of the building	The external condition of the building is in normal condition
C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Normal Condition
2	Columns (Cracks & Leakages)	Normal Condition
3	Ceiling (Cracks & Leakages)	Normal Condition
4	Leakages inside the property	Not Found
5	Painting inside the property	Normal
6	Maintenance of staircase & cracks	Normal

D	Common Observation	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal

E	Conclusion
	<p>The captioned building is having Ground + 4 Upper Floor which are constructed in year 1999 (Approx.). Estimated future life under present circumstances is about 35 years' subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 08.06.2024 reveals no structural damage or deterioration to the building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs.</p> <p>Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only.</p>

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

Manoj Chalikwar

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. (N) IBBI/RV/07/2018/10366

JSB Emp. No. 36/LOAN H.O./2016-17/232



Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual Site Photographs

