

## Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report Prepared for SBI / RACPC Kalyan / Mrs. Dipika Deepak Joshi (011402/2308307)

Page 1 of 4

Vastu/Thane/09/2024/011402/2308307

23/12-313-PSRJ

Date: 23 09 2024

### Structural Stability Report

Structural Observation Report of Residential Flat No. 102, 1<sup>st</sup> Floor, "Shree Jankidas Shelter Co-Op. Hsg. Soc. Ltd.", Near Telawane Hospital, Kasbe, Bhartacharya Vaidya Chowk, Ghodekhot Ali, Village - Kalyan, Taluka - Kalyan, District - Thane, Kalyan (West), PIN Code - 421 301, State - Maharashtra, India.

Name of Owner: **Mrs. Dipika Deepak Joshi, Mr. Deepak Subhash Joshi & Mr. Subhash Dattatray Joshi**

This is to certify that on visual inspection, it appears that the structure of the at "Shree Jankidas Shelter Co-Op. Hsg. Soc. Ltd.", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 36 years.

#### General Information:

A.		Introduction
1	Name of Building	"Shree Jankidas Shelter Co-Op. Hsg. Soc. Ltd."
2	Property Address	Residential Flat No. 102, 1 <sup>st</sup> Floor, "Shree Jankidas Shelter Co-Op. Hsg. Soc. Ltd.", Near Telawane Hospital, Kasbe, Bhartacharya Vaidya Chowk, Ghodekhot Ali, Village - Kalyan, Taluka - Kalyan, District - Thane, Kalyan (West), PIN Code - 421 301, State - Maharashtra, India.
3	Type of Building	Residential used
4	No. of Floors	(Part) Ground + (Part) Still + 4 <sup>th</sup> Upper Floors
5	Whether still / podium / open parking provided	Open Parking
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	2000 (As per Building Completion Certificate)
11	Present age of building	24 years
12	Residual age of the building	36 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	03 Flats on 1 <sup>st</sup> Floor
14	Methodology adopted	As per visual site inspection

B.		External Observation of the Building
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found



Nanded: 28, S.G.G.S Stadium Complex, Nanded - 431 602, (M.S), INDIA

Email: nanded@vastukala.co.in | Tel: +91 2462 244288 +91 94221 71100

Our Pan India Presence at:

- Nanded
- Thane
- Ahmedabad
- Delhi NCR
- Mumbai
- Nashik
- Rajkot
- Raipur
- Aurangabad
- Pune
- Indore
- Jaipur

**Regd. Office**

81-001, U/B Floor, BOOMERANG, Chandvati Form Road, Powai, Andheri East, Mumbai: 400072, (M.S), India

+81 2247495818

mumbai@vastukala.co.in

www.vastukala.co.in

6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
<b>C</b>	<b>Internal Observation of the common areas of the building and captioned premises</b>	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Normal Condition
6	Maintenance of staircase & cracks	Good

<b>D</b>	<b>Common Observation</b>	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

<b>E</b>	<b>Conclusion</b>
<p>The captioned building is having (Part) Ground + (Part) Stilt + 4<sup>th</sup> Upper Floors which are constructed in year 2000 (As per Building Completion Certificate). Estimated future life under present circumstances is about 36 years subject to proper, preventive periodic maintenance &amp; structural repairs.</p> <p>The inspection dated 21.05.2024 of building. The building is well as the property is maintained in normal condition &amp; will stand future life subject to proper, preventive periodic maintenance &amp; Good structural repairs.</p> <p>Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Sharadkumar  
Chalikwar

Digitally signed by Sharadkumar Chalikwar  
DN: cn=Sharadkumar Chalikwar, o=Vastukala  
Consultants (I) Pvt Ltd., ou=Mumbai,  
email=cmd@vastukala.org, c=IN  
Date: 2024.09.23 15:48:06 +05'30'



Auth. Sign.

Director

Sharadkumar B. Chalikwar

Structural Engineer Licence No. STATE/R/2022/APL/01785

Govt. Reg. Valuer

Chartered Engineer (India)

Reg No. (N) CCIT/1-14/52/2008-09

SBI Empanelment No.: SME / TCC / 2021 – 22 / 85 / 13



Since 1989






Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company






## Actual site photographs

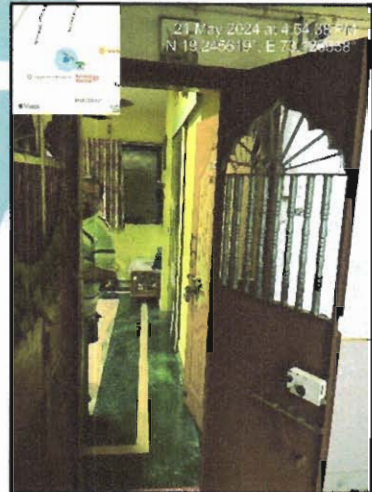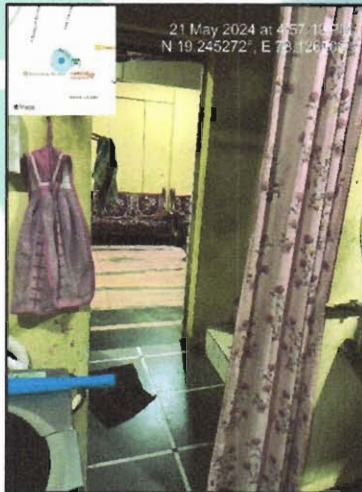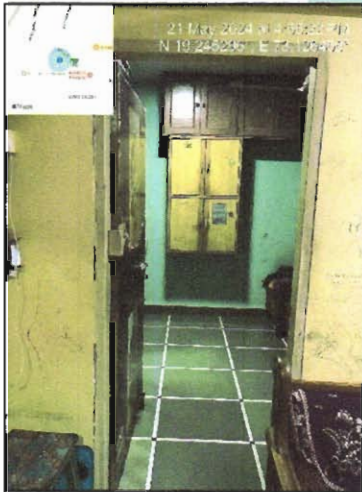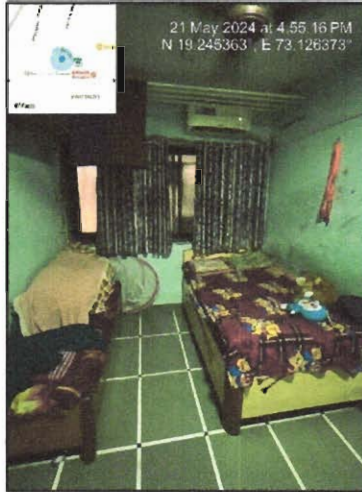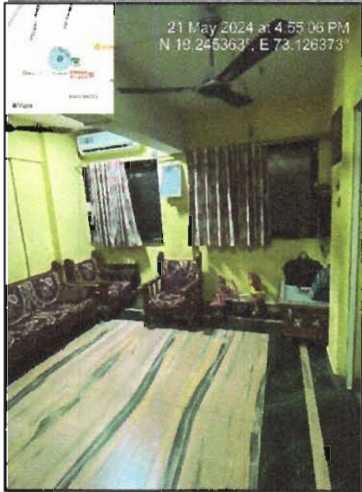

## Actual site photographs

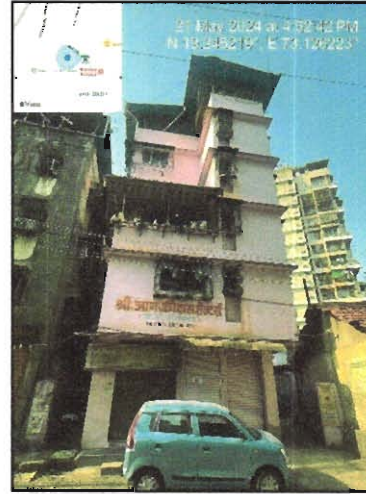

Since 1989

**Vastukala Consultants (I) Pvt. Ltd.**

An ISO 9001 : 2015 Certified Company

