



VASTUKALA
Unlocking Excellence

www.vastukala.co.in

MSME Reg No: UDYAM-MH-18-0083617

An ISO 9001 : 2015 Certified Company

CIN: U74120MH2010PTC207869

Vastukala Consultants (I) Pvt. Ltd.

Page 1 of 3

Vastu/Thane/10/2024/011576/2308480

01/20-20-PRRJ

Date: 01.10.2024

Structural Stability Report

Structural Observation Report of Residential Row House Bearing No. 135/2E (Row House No. 135/6), CIDCO Row House No. 06, Ground plus First Floor, "Trailokya Co-Op. Hsg. Soc. Ltd.", Plot Nos. 130 to 141, Sector – 2E, Village – Airoli, Navi Mumbai, Taluka & District - Thane, PIN - 400 708, State - Maharashtra, Country - India.

Name of Owner: **Mrs. Sarita Dharmendra Chaurasia & Mr. Dharmendra Chaurasia**

This is to certify that on visual inspection, it appears that the structure of the at "Trailokya Co-Op. Hsg. Soc. Ltd.", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 26 years.

General Information:

A.	Introduction	
1	Name of Building	" Trailokya Co-Op. Hsg. Soc. Ltd."
2	Property Address	Residential Row House Bearing No. 135/2E (Row House No. 135/6), CIDCO Row House No. 06, Ground plus First Floor, "Trailokya Co-Op. Hsg. Soc. Ltd.", Plot Nos. 130 to 141, Sector – 2E, Village – Airoli, Navi Mumbai, Taluka & District - Thane, PIN - 400 708, State - Maharashtra, Country – India.
3	Type of Building	Residential used
4	No. of Floors	Ground + 1 st Upper Floors
5	Whether stilt / podium / open parking provided	Open Car Parking Space
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1990 (As per CIDCO Allotment Letter)
11	Present age of building	34 years
12	Residual age of the building	26 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	Independent Row House
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found



Thane : 101, 1st Floor, Beth Shalom, Near Civil Hospital, Thane (W) - 400601, (M.S),INDIA
Email :thane@vastukala.co.in | Tel : 80978 82976 / 90216 05621

Our Pan India Presence at :

Nanded Thane Ahmedabad Delhi NCR
Mumbai Nashik Rajkot Raipur
Aurangabad Pune Indore Jaipur

Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, Mumbai :- 400072, (M.S), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in

7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Normal Condition
6	Maintenance of staircase & cracks	Good

D	Common Observation	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

E	Conclusion
<p>The captioned building is having Ground + 1st Upper Floors which are constructed in year 1990 (As per CIDCO Allotment Letter) Estimated future life under present circumstances is about 26 years subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 28.09.2024 of building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Sharadkumar
Chalikwar

Director

Sharadkumar B. Chalikwar

Structural Engineer Licence No. STATE/R/2022/APL/01785

Govt. Reg. Valuer

Chartered Engineer (India)

Reg No. (N) CCIT/1-14/52/2008-09

SBI Empanelment No.: SME / TCC / 2021 – 22 / 85 / 13

Digitally signed by Sharadkumar Chalikwar
DN: cn=Sharadkumar Chalikwar, o=Vastukala
Consultants (I) Pvt. Ltd., ou=Mumbai,
email=cmd@vastukala.org, c=IN
Date: 2024.10.01 17:58:55 +05'30'


Auth. Sign.



Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual site Photographs

