

## Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report Prepared for SVC / Kalwa / Rajendra Y. Keni (012494/2309149)

Page 1 of 4

Vastu/Thane/11/2024/012494/2309149

22/1-234-PSRJ

Date: 21.11.2024

### Structural Stability Report

Structural Observation Report of Residential Flat No. A-1, 1<sup>st</sup> Floor, "kirtida Apartment Co-Op. Hsg. Soc. Ltd.", M. D. Keni Road, Village - Bhandup, Taluka - Kurla, District - Mumbai Suburban, Bhandup (East), PIN Code - 400 042, State - Maharashtra, India.

Name of Owner: **Rajendra Y. Keni & Arvind Y. Keni**

This is to certify that on visual inspection, it appears that the structure of the at "kirtida Apartment Co-Op. Hsg. Soc. Ltd.", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 27 years.

#### General Information:

A.	Introduction	
1	Name of Building	"kirtida Apartment Co-Op. Hsg. Soc. Ltd."
2	Property Address	Residential Flat No. A-1, 1 <sup>st</sup> Floor, "kirtida Apartment Co-Op. Hsg. Soc. Ltd.", M. D. Keni Road, Village - Bhandup, Taluka - Kurla, District - Mumbai Suburban, Bhandup (East), PIN Code - 400 042, State - Maharashtra, India
3	Type of Building	Residential used
4	No. of Floors	Ground + 4 <sup>th</sup> Upper Floors
5	Whether stilt / podium / open parking provided	Open Parking
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1991 (As per occupancy certificate)
11	Present age of building	33 years
12	Residual age of the building	27 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	1 <sup>st</sup> Floor having 3 Flats
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found



Thane : 101, 1st Floor, Beth Shalom, Near Civil Hospital, Thane (W) - 400601, (M.S),INDIA  
Email :thane@vastukala.co.in | Tel : 80978 82976 / 90216 05621

#### Our Pan India Presence at :


 Nanded Thane Ahmedabad Delhi NCR  
 Mumbai Nashik Rajkot Raipur  
 Aurangabad Pune Indore Jaipur

#### Regd. Office

B1-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, Mumbai :- 400072, (M.S), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in

8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
<b>C</b>	<b>Internal Observation of the common areas of the building and captioned premises</b>	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Good Condition
6	Maintenance of staircase & cracks	Good

<b>D</b>	<b>Common Observation</b>	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

<b>E</b>	<b>Conclusion</b>
<p>The captioned building is having Ground + 4<sup>th</sup> Upper Floors Upper Floors which are constructed in year 1991 (As per occupancy certificate) Estimated future life under present circumstances is about 27 years subject to proper, preventive periodic maintenance &amp; structural repairs.</p> <p>The inspection dated 18.11.2024 of building. The building is well as the property is maintained in good condition &amp; will stand future life subject to proper, preventive periodic maintenance &amp; Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Sharadkumar  
Chalikwar

Digital signed by Sharadkumar Chalikwar  
DN: cn=Sharadkumar Chalikwar, o=Vastukala  
Consultants (I) Pvt. Ltd., ou=Mumbai,  
email=cmr@vastukala.org, c=IN  
Date: 2024.11.22 10:51:25 +05'30'

Director

Auth. Sign.

Sharadkumar B. Chalikwar

Structural Engineer Licence No. STATE/R/2022/APL/01785

Govt. Reg. Valuer

Chartered Engineer (India)

Reg No. (N) CCIT/1-14/52/2008-09



Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company





## Actual site photographs



## Actual site photographs

