

# Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report / SBI / RACPC Chinchpokli / Mr. Rohit Kumar (013367/2309825)

Page 1 of 4

www.vastukala.co.in

Vastu/Mumbai/12/2024/013367/2309825  
27/18-523-SK  
Date: 27.12.2024

## Structural Stability Report

Structural Observation Report of Residential Flat No. 101, 1st Floor, Building No 17, "**Glenmark**", Highland Residency 'D' Co - Op Hsg. Soc. Ltd., Dhokali Naka, Kolshet Road, Village - Dhokali, Thane (West), Taluka - Thane, District - Thane, PIN- 400607, State - Maharashtra, India.

Name of Owner: **Mr. Vijay Jagannath Ahire & Mrs. Anuradha Vijay Ahire**

Name of Proposed Purchaser: **Mr. Rohit Kumar & Mrs. Neha Rohit Roy**

This is to certify that on visual inspection, it appears that the structure of the at "**Glenmark**", is in good condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 41 years.

### General Information:

A.	Introduction	
1	Name of Building	<b>Glenmark</b>
2	Property Address	Residential Flat No. 101, 1st Floor, Building No 17, " <b>Glenmark</b> ", Highland Residency 'D' Co - Op Hsg. Soc. Ltd., Dhokali Naka, Kolshet Road, Village - Dhokali, Thane (West), Taluka - Thane, District - Thane, PIN- 400607, State - Maharashtra, India.
3	Type of Building	Residential used
4	No. of Floors	Ground + 7 <sup>th</sup> Upper Floors
5	Whether stilt / podium / open parking provided	Open Car Parking Space
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	2007 (As per site information)
11	Present age of building	17 years
12	Residual age of the building	43 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	4 Flats on 1 <sup>st</sup> Floor
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Not Found
2	Chajjas	Not Found



### Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur

### Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai**: 400072, (M.S.), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in



3	Plumbing	Not Found
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
<b>C</b>	<b>Internal Observation of the common areas of the building and captioned premises</b>	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Not Found
6	Maintenance of staircase & cracks	Good

<b>D</b>	<b>Common Observation</b>	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

<b>E</b>	<b>Conclusion</b>
<p>The captioned building is having Ground + 7<sup>th</sup> Upper Floors which are constructed in year 2007 (As per site information) Estimated future life under present circumstances is about 43 years subject to proper, preventive periodic maintenance &amp; structural repairs.</p> <p>The inspection dated 16.12.2024 of building. The building is well as the property is maintained in good condition &amp; will stand future life subject to proper, preventive periodic maintenance &amp; Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

Sharadkumar B. Chalikwar

Structural Engineer Licence No. STATE/R/2022/APL/01785

Govt. Reg. Valuer

Chartered Engineer (India)

Reg No. (N) CCIT/1-14/52/2008-09

SBI Panelment No.: SME / TCC / 2021 – 22 / 85 / 13



Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



## Actual site photographs



## Actual site photographs

