



VASTUKALA
Unlocking Excellence

www.vastukala.co.in

MSME Reg No: UDYAM-MH-18-0083617

An ISO 9001 : 2015 Certified Company

CIN: U74120MH2010PTC207869

Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report / SBI / RASMECCC Bhayandar Branch / Mr. Lalit K. Shah (13594/2310023) Page 1 of 3

Vastu/Mumbai/01/2025/13594/2310023

13/03-142-SOSK

Date: 10.01.2025

Structural Stability Report

Structural Observation Report of Residential Flat No. 501, 5th Floor, Wing - A, "New Lavlesh Enclave Co-Op. Hsg. Soc. Ltd.", Lavlesh Enclave Phase – I, Aai Mata Road, Behind Seven Square Academy, Ramdev Park, Village - Goddev, Mira Road (East), Taluka - Thane, District - Thane, 401 107, State - Maharashtra, India.

Name of Owner: **Mr. Lalit K. Shah**

This is to certify that on visual inspection, it appears that the structure of the at "**New Lavlesh Enclave Co. Op. Hsg. Soc. Ltd.**", is in Normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 36 years.

General Information:

| A. | Introduction | |
|----|--|---|
| 1 | Name of Building | " New Lavlesh Enclave Co. Op. Hsg. Soc. Ltd. " |
| 2 | Property Address | Residential Flat No. 501, 5 th Floor, Wing - A, " New Lavlesh Enclave Co-Op. Hsg. Soc. Ltd. ", Lavlesh Enclave Phase – I, Aai Mata Road, Behind Seven Square Academy, Ramdev Park, Village - Goddev, Mira Road (East), Taluka - Thane, District - Thane, 401 107, State - Maharashtra, India. |
| 3 | Type of Building | Residential used |
| 4 | No. of Floors | Ground + 7 th Upper Floors |
| 5 | Whether stilt / podium / open parking provided | Open Car Parking Space |
| 6 | Type of Construction | R.C.C. Framed Structure |
| 7 | Type of Foundation | R.C.C. Footing |
| 8 | Thickness of the External Walls | 9" thick brick walls both sides plastered |
| 9 | Type of Compound | Brick Masonry Walls |
| 10 | Year of Construction | 2001 (As Per Occupancy Certificate) |
| 11 | Present age of building | 24 years |
| 12 | Expected Balance life of the building | 36 years Subject to proper, preventive periodic maintenance & structural repairs. |
| 13 | No. of flats (Per Floor) | 04 Flats on 5 th Floor |
| 14 | Methodology adopted | As per visual site inspection |

| B. | External Observation of the Building | |
|----|--------------------------------------|--------------------|
| 1 | Plaster | Normal Condition |
| 2 | Chajjas | Normal Condition |
| 3 | Plumbing | Normal Condition |
| 4 | Cracks on the external walls | Minor Cracks Found |
| 5 | Filling cracks on the external walls | Found |
| 6 | Cracks on columns & beams | Not Found |



Our Pan India Presence at :

- Nanded
- Thane
- Ahmedabad
- Delhi NCR
- Mumbai
- Nashik
- Raikot
- Raipur
- Aurangabad
- Pune
- Indore
- Jaipur

Regd. Office

B1-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai:** 400072, (M.S), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in

| | | |
|----------|--|---|
| 7 | Vegetation | Nor Found |
| 8 | Leakages of water in the drainage pipes or water pipes | Not Found |
| 9 | Dampness external in the wall due to leakages | Not Found |
| 10 | Any other observation about the condition of external side of the building | Structural Stability Report from licensed structural engineers not provided for our verification. |
| C | Internal Observation of the common areas of the building and captioned premises | |
| 1 | Beams (Cracks & Leakages) | Not Found |
| 2 | Columns (Cracks & Leakages) | Not Found |
| 3 | Ceiling (Cracks & Leakages) | Not Found |
| 4 | Leakages inside the property | Minor Leakages Found |
| 5 | Painting inside the property | Normal Condition |
| 6 | Maintenance of staircase & cracks | Nor Found |

| | | |
|----------|---|--|
| D | Common Observation | |
| 1 | Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules) | As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows |
| 2 | Remark | No Structural Audit Report is furnished for the perusal. |

| | |
|--|-------------------|
| E | Conclusion |
| <p>The captioned building is having Ground + 7th Upper Floors which are constructed in year 2001 (As Per Occupancy Certificate) Estimated future life under present circumstances is about 36 years subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 10.01.2025 of building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p> | |

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Manoj
Chalikwar

Director

Manoj Baburao Chalikwar

Structural Engineer Licence No. STATE/R/2025/APL/15680

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. IBBI/RV/07/2018/10366

SBI Empanelment No.: SME/TCC/38/IBBI/3

Digitally signed by Manoj Chalikwar
DN: cn=Manoj Chalikwar, o=Vastukala
Consultants (I) Pvt. Ltd., ou=Mumbai,
email=manoj@vastukala.org, c=IN
Date: 2025.01.13 11:34:29 +05'30'



Auth. Sign.






Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual site photographs

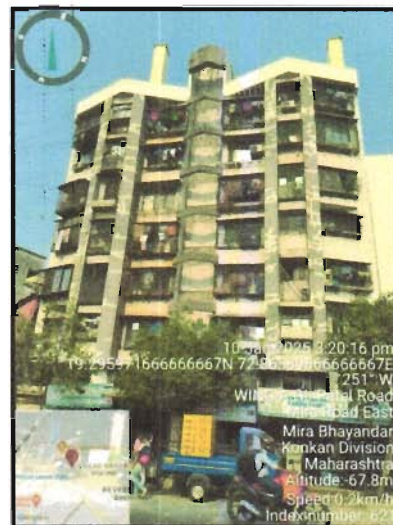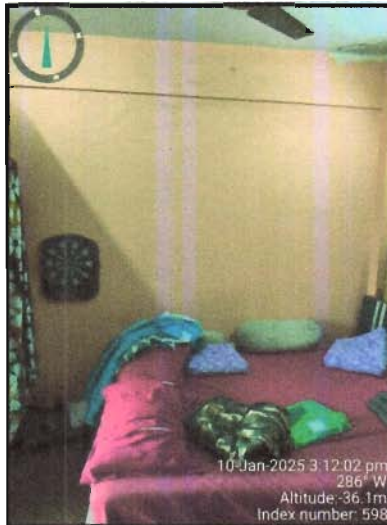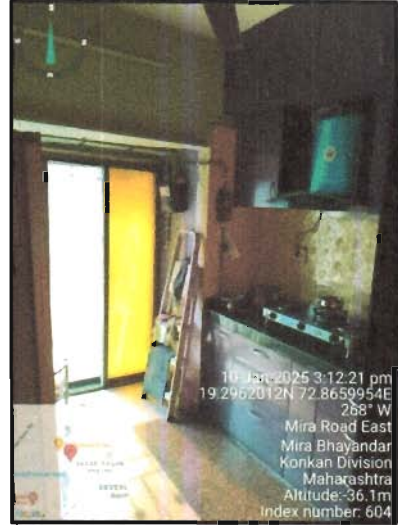

Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company

