

Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report Prepared for SBI / RACPC Andheri (East) / Mr. Minjurpet Narasimhan Ravi (013695/2310072) Page 1 of 3

www.vastukala.co.in

Vastu/Mumbai/01/2025/013695/2310072
16/05-191-JAV
Date: 16.01.2025

Structural Stability Report

Structural Observation Report of Residential Flat No. 202, 2nd Floor, Wing - B, "**Raj Rudram Co-op. Hsg. Soc. Ltd.**", Goregaon -Mulund Link Road, Village - Malad (East), Municipality Ward No. P/S, Gokuldham, Taluka - Borivali, District - Mumbai Suburban, Goregaon (East), Mumbai - 400 063, State - Maharashtra, Country - India.

Name of Owner: **Mr. Minjurpet Narasimhan Ravi & Mrs. Akila Ravi**

This is to certify that on visual inspection, it appears that the structure at "**Raj Rudram Co-op. Hsg. Soc. Ltd.**" is in good condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 39 years.

General Information:

A.	Introduction	
1	Name of Building	" Raj Rudram Co-op. Hsg. Soc. Ltd. "
2	Property Address	Residential Flat No. 202, 2 nd Floor, Wing - B, " Raj Rudram Co-op. Hsg. Soc. Ltd. ", Goregaon -Mulund Link Road, Village - Malad (East), Municipality Ward No. P/S, Gokuldham, Taluka - Borivali, District - Mumbai Suburban, Goregaon (East), Mumbai - 400 063, State - Maharashtra, Country - India.
3	Type of Building	Residential
4	No. of Floors	Stilt + 7 Upper Floors
5	Whether stilt / podium / open parking provided	Open Parking Space No. P13
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	2004 (As per Occupancy Certificate)
11	Present age of building	21 years
12	Expected balance lift of fthe building	39 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	2 nd Floor is having 4 Flats
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Good Condition
2	Chajjas	Good Condition
3	Plumbing	Good Condition
4	Cracks on the external walls	Not Found



Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur

Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai:** 400072, (M.S.), India

 +91 2247495919

 mumbai@vastukala.co.in

 www.vastukala.co.in



5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Good Condition
6	Maintenance of staircase & cracks	Good

D	Common Observation	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	<p>i) At the time of site inspection, external condition of the building is in good condition, dampness not found, leakages are not found & Cracks are not found.</p> <p>ii) Structural Stability Report from licensed structural engineers not provided for our verification.</p>

E	Conclusion
<p>The captioned building is having Stilt + 7 Upper Floors which are constructed in year 2004 (As per Occupancy Certificate). Estimated future life under present circumstances is about 39 years subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 15.01.2025 of building. The building is well as the property is maintained in good condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs.</p> <p>Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

Manoj Chalikwar

Structural Engineer Licence No. STATE/R/2025/APL/15680

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. IBBI/RV/07/2018/10366

State Bank of India Empanelment No.: SME/TCC/38/IBBI/3




Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual site photographs

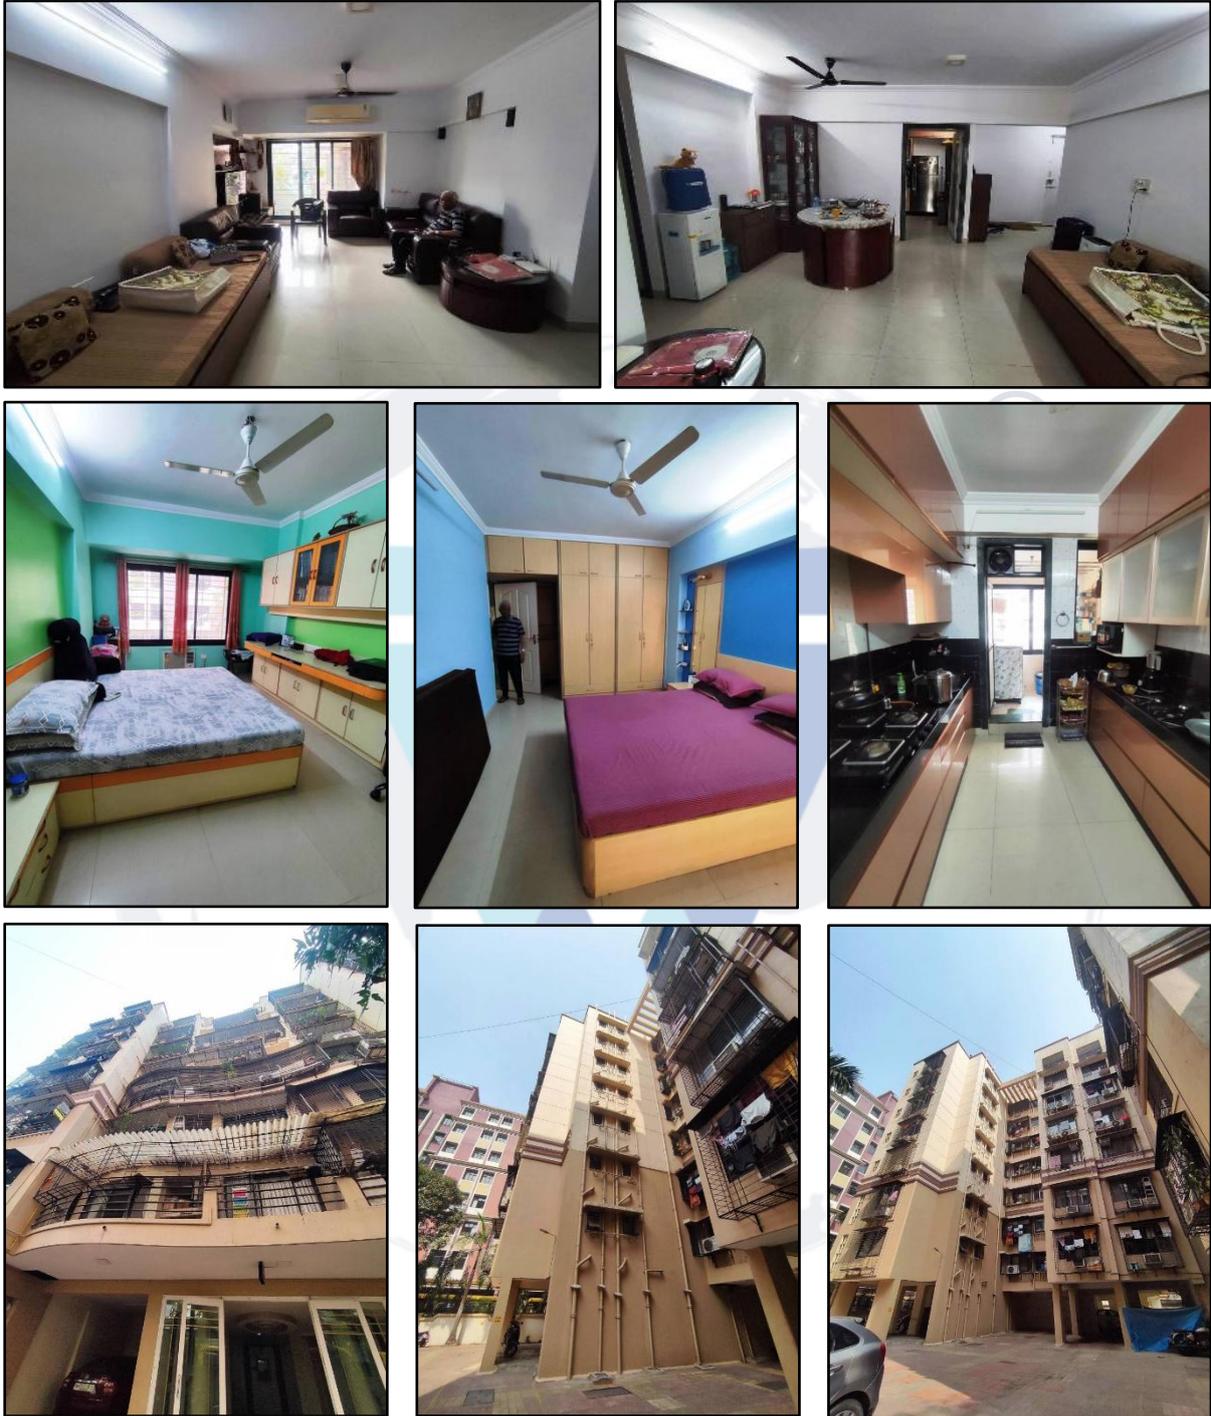

Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company

