

Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report / SBI / Jawahar Nagar-2 Branch- Goregaon (West) / Mr. Rrahul Jitendra Shah (13746/2310103) Page 1 of 3

www.vastukala.co.in

Vastu/Mumbai/01/2025/13746/2310103
18/06-222-SOVS
Date: 18.01.2025

Structural Stability Report

Structural Observation Report of Residential Flat No. 37, 1st Floor, Building No 2, Wing - A, "**Borivali Ganjawala Co-op. Hsg. Soc. Ltd.**", S. V. P. Road, Village - Eksar, Borivali (West), Taluka - Borivali, District - Mumbai Suburban, Mumbai, PIN - 400 092, State - Maharashtra, India.

Name of Owner: **Mr. Rrahul Jitendra Shah & Mr. Sumit Jitendra Shah**

This is to certify that on visual inspection, it appears that the structure of the at "**Borivali Ganjawala Co-op. Hsg. Soc. Ltd.**", is in Good condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 13 years.

General Information:

A.	Introduction	
1	Name of Building	" Borivali Ganjawala Co-op. Hsg. Soc. Ltd. "
2	Property Address	Residential Flat No. 37, 1 st Floor, Building No 2, Wing - A, " Borivali Ganjawala Co-op. Hsg. Soc. Ltd. ", S. V. P. Road, Village - Eksar, Borivali (West), Taluka - Borivali, District - Mumbai Suburban, Mumbai, PIN - 400 092, State - Maharashtra, India.
3	Type of Building	Residential used
4	No. of Floors	Ground + 14 th Upper Floors
5	Whether stilt / podium / open parking provided	Open Car Parking Space
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1977 (As Per Occupancy Certificate)
11	Present age of building	47 years
12	Expected Balance life of the building	13 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	3 Flats on 1 st Floor
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Good Condition
2	Chajjas	Good Condition
3	Plumbing	Good Condition
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found
6	Cracks on columns & beams	Not Found




Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur

Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai:** 400072, (M.S), India

 +91 2247495919

 mumbai@vastukala.co.in

 www.vastukala.co.in



7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Good Condition
6	Maintenance of staircase & cracks	Good Condition

D	Common Observation	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

E	Conclusion
<p>The captioned building is having Ground + 14th upper floors which are constructed in year 1977 (As Per Occupancy Certificate) Estimated future life under present circumstances is about 13 years subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 07.11.2024 of building. The building is well as the property is maintained in good condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

Manoj Baburao Chalikwar

Structural Engineer Licence No. STATE/R/2025/APL/15680

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. IBBI/RV/07/2018/10366

SBI Empanelment No.: SME/TCC/38/IBBI/3



Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual site photographs

