

# Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report / SBI / RACPC Borivali (West) / Mr. V. K. Anthony (13760/2310154) Page 1 of 4

www.vastukala.co.in

Vastu/Mumbai/01/2025/13760/2310154  
22/03-273-SKVS  
Date: 22.01.2025

## Structural Stability Report

Structural Observation Report of Residential Flat No. 404, 4th Floor, Wing - B, "**Panchvan**", Panchvan Complex Co-op. Hsg. Soc. Ltd., I. C. Colony, Off. Laxman Mhatre Road, Behind Mary Immaculate Girls High School, Village - Eksar, Borivali (West), Taluka - Borivali, District - Mumbai, 400103, Maharashtra, India.


**Name of Owner:** Mr. V. K. Anthony & Mrs. Merly Anthony

This is to certify that on visual inspection, it appears that the structure of the at "**Panchvan**", **Panchvan Complex Co-op. Hsg. Soc. Ltd.**", is in good and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 30 years.

### General Information:

A.	Introduction	
1	Name of Building	"Panchvan", Panchvan Complex Co-op. Hsg. Soc. Ltd.,
2	Property Address	Residential Flat No. 404, 4th Floor, Wing - B, "Panchvan", Panchvan Complex Co-op. Hsg. Soc. Ltd., I. C. Colony, Off. Laxman Mhatre Road, Behind Mary Immaculate Girls High School, Village - Eksar, Borivali (West), Taluka - Borivali, District - Mumbai, 400103, Maharashtra, India.
3	Type of Building	Residential used
4	No. of Floors	Stilt + 7 <sup>th</sup> Upper Floors
5	Whether stilt / podium / open parking provided	Open Parking
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1995 (As per Occupancy Certificate)
11	Present age of building	30 years
12	Expected Residual age of the building	30 years Subject to proper, preventive periodic maintenance & structural repairs.
13	No. of flats (Per Floor)	4 Flats on 4 <sup>th</sup> Floor
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Good Condition
2	Chajjas	Good Condition
3	Plumbing	Good Condition
4	Cracks on the external walls	Not Found
5	Filling cracks on the external walls	Not Found

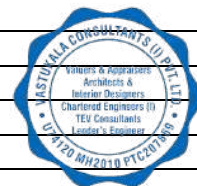

### Our Pan India Presence at :

-  Nanded
-  Thane
-  Ahmedabad
-  Delhi NCR
-  Mumbai
-  Nashik
-  Rajkot
-  Raipur
-  Aurangabad
-  Pune
-  Indore
-  Jaipur


### Regd. Office

BI-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, Mumbai: 400072, (M.S.), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in

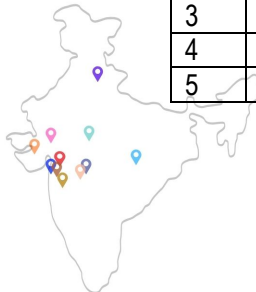

6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	Structural Stability Report from licensed structural engineers not provided for our verification.
<b>C Internal Observation of the common areas of the building and captioned premises</b>		
1	Beams (Cracks & Leakages)	Not Found
2	Columns (Cracks & Leakages)	Not Found
3	Ceiling (Cracks & Leakages)	Not Found
4	Leakages inside the property	Not Found
5	Painting inside the property	Good Condition
6	Maintenance of staircase & cracks	Good

<b>D</b>	<b>Common Observation</b>	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

<b>E</b>	<b>Conclusion</b>
<p>The captioned building is having Stilt + 7<sup>th</sup> Upper Floors which are constructed in year 1995 (As per site information) Estimated future life under present circumstances is about 30 years subject to proper, preventive periodic maintenance &amp; structural repairs.</p> <p>The inspection dated 20.01.2025 of building. The building is well as the property is maintained in good condition &amp; will stand future life subject to proper, preventive periodic maintenance &amp; Good structural repairs. Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

Director

Auth. Sign.

**Manoj Baburao Chalikwar**

Structural Engineer Licence No. STATE/R/2025/APL/15680

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. IBBI/RV/07/2018/10366

SBI Panelment No.: SME/TCC/38/IBBI/3



Since 1989




**Vastukala Consultants (I) Pvt. Ltd.**

An ISO 9001 : 2015 Certified Company





## Actual site photographs

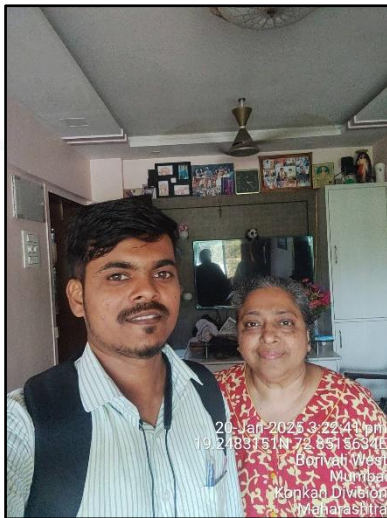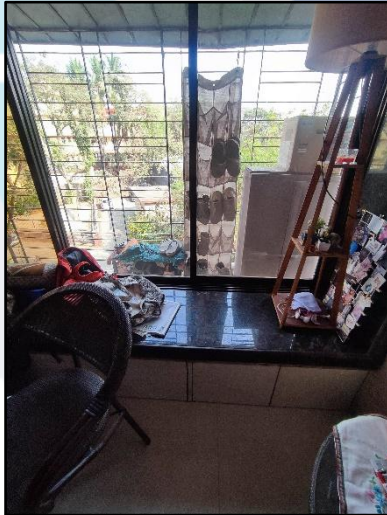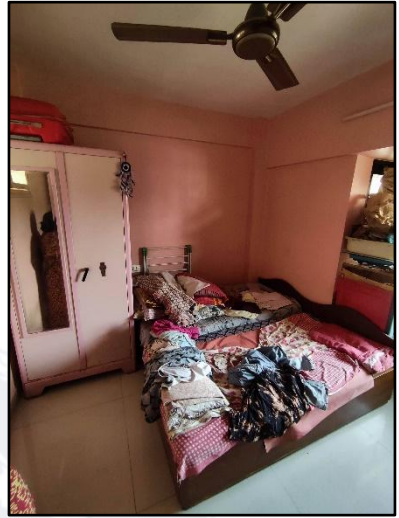



## Actual site photographs

