

# Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report Prepared for JSB / Goregaon (West) Branch / Mr. Gangaram K. Bhoir (14226/2310496)

www.vastukala.co.in

Vastu/Mumbai/02/2025/14226/2310496 11/05-146-SOV Date: 11.02.2025

## Structural Stability Report

Structural Observation Report of Residential Flat No. 305, 3rd Floor, Building No. 4, "Shree Swami Samarth Co-Op. Hsg. Soc. Ltd.", M. G. Road, Sane Guruji Nagar, Teen Dongri, Village - Pahadi Goregaon, Goregoan (West), Taluka - Borivali, District - Mumbai Suburban, Mumbai, 400 104, State - Maharashtra, India.

Name of Owner: Mr. Lalit K. Shah

This is to certify that on visual inspection, it appears that the structure of the at "Shree Swami Samarth Co-Op. Hsg. Soc. Ltd.", is in Normal condition and the future life can be reasonably taken under Normal condition and with proper periodic repairs & maintenance is about 10 years.

#### **General Information:**

A.		Introduction
1	Name of Building	"Shree Swami Samarth Co-Op. Hsg. Soc. Ltd."
2	Property Address	Residential Flat No. 305, 3rd Floor, Building No 4, "Shree
		Swami Samarth Co-Op. Hsg. Soc. Ltd.", M. G. Road,
		Sane Guruji Nagar, Teen Dongri, Village - Pahadi
		Goregaon, Goregoan (West), Taluka - Borivali, District -
		Mumbai Suburban, Mumbai, 400 104, State - Maharashtra,
		India
3	Type of Building	Residential used
4	No. of Floors	Ground + 4th Upper Floors
5	Whether stilt / podium / open parking	Open Car Parking Space
	provided	
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1975 (As per site information)
11	Present age of building	50 years
12	Expected Balance life of the building	10 years Subject to proper, preventive periodic
		maintenance & structural repairs.
13	No. of flats (Per Floor)	08 Flats on 3 <sup>th</sup> Floor
14	Methodology adopted	As per visual site inspection
	1	

B.	External Observation of the Building		
1	Plaster	Normal Condition	
2	Chajjas	Normal Condition	SULTANTS
3	Plumbing		& Appraisers E
4	Cracks on the external walls	Minor Cracks Found	or Designers ed Engineers (I) Consultants
5	Filling cracks on the external walls	Found	er's Engineer (SS)
6	Cracks on columns & beams	Some Places	2010

### Our Pan India Presence at:

Nanded

Thane

💡 Ahmedabad 💡 Delhi NCR

Mumbai Nashik 💡 Rajkot Aurangabad
Pune  💡 Raipur 💡 Jaipur

#### Regd. Office

B1-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, Mumbai: 400072, (M.S), India



🔀 mumbai@vastukala.co.in www.vastukala.co.in



Structura	Structural Stability Report Prepared for JSB / Goregaon (West) Branch / Mr. Gangaram K. Bhoir (14226/2310496) Page 2 of 3			
7	Vegetation	Found		
8	Leakages of water in the drainage pipes	Found		
	or water pipes			
9	Dampness external in the wall due to	Found		
	leakages			
10	Any other observation about the condition	Structural Stability Report from licensed structural		
	of external side of the building	engineers not provided for our verification.		
1	_	origination for provided for ear vermedation.		
С	Internal Observation of the comm	on areas of the building and captioned premises		
<b>C</b>	Internal Observation of the comm Beams (Cracks & Leakages)			
<b>C</b> 1 2		on areas of the building and captioned premises		
1	Beams (Cracks & Leakages)	on areas of the building and captioned premises  Not Found		
1	Beams (Cracks & Leakages) Columns (Cracks & Leakages)	on areas of the building and captioned premises  Not Found  Found		
1 2 3	Beams (Cracks & Leakages) Columns (Cracks & Leakages) Ceiling (Cracks & Leakages)	on areas of the building and captioned premises  Not Found  Found  Found		

D	Common Observation	
1	Structural Audit of the Building Under Bye	As per bye Laws No. 77 of Co-Op. Societies bye Laws
	- Laws No. 77 of the Model Bye Laws (Co-	under the Act the society shall conduct a Structural Audit of
	Operative Societies Act / Rules)	the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

#### E Conclusion

The captioned building is having Ground + 4<sup>th</sup> Upper Floors which are constructed in year 1975 (As Per site information) Estimated future life under present circumstances is about 10 years subject to proper, preventive periodic maintenance & structural repairs.

The inspection dated 08.02.2025 of building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & normal structural repairs. Our Observations about the structure are given above.

The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.

## For VASTUKALA CONSULTANTS (I) PVT. LTD.

### Director

Auth. Sign.

Manoj Baburao Chalikwar

Structural Engineer Licence No. STATE/R/2025/APL/15680

Govt. Reg. Valuer

Chartered Engineer (India)

Reg. No. IBBI/RV/07/2018/10366

Janaseva Sahakari Bank (Borivali) LTD Empanelment No.: 36/ LOAN H.O./2016-17/232





An ISO 9001: 2015 Certified Company

# **Actual site photographs**





















