



VASTUKALA
Unlocking Excellence

www.vastukala.co.in

MSME Reg No: UDYAM-MH-18-0083617

An ISO 9001 : 2015 Certified Company

CIN: U74120MH2010PTC207869

Vastukala Consultants (I) Pvt. Ltd.

Structural Stability Report Prepared For: SBI / SPL PBB Fort/ Mr. Subodh Tukaram Kachare Page 1 of 3

Vastu/Mumbai/03/2025/014621/2310814

01/11-11-PSH

Date: 01.03.2025

Structural Stability Report

Structural Observation Report of Residential Flat No. 203, 2nd Floor, Wing - C, "Ankit Co-op. Hsg. Soc. Ltd.", Chandresh Galaxy, Barave Road, Godrej Hill Road, Village - Gandhare, Municipality Ward No. 8-C-2, Kalyan (West), Taluka - Kalyan, District - Thane, PIN - 421 301, State - Maharashtra, India.

Name of Owner: **Mr. Subodh Tukaram Kachare**

This is to certify that on visual inspection, it appears that the structure of the at "Ankit Co-op. Hsg. Soc. Ltd.", is in normal condition and the future life can be reasonably taken under good condition and with proper periodic repairs & maintenance is about 34 years.

General Information:

A.	Introduction	
1	Name of Building	"Ankit Co-op. Hsg. Soc. Ltd."
2	Property Address	Residential Flat No. 203, 2nd Floor, Wing - C, "Ankit Co-op. Hsg. Soc. Ltd.", Chandresh Galaxy, Barave Road, Godrej Hill Road, Village - Gandhare, Municipality Ward No. 8-C-2, Kalyan (West), Taluka - Kalyan, District - Thane, PIN - 421 301, State - Maharashtra, India
3	Type of Building	Residential used
4	No. of Floors	Ground + 7 Upper Floors
5	Whether stilt / podium / open parking provided	Open Car Parking
6	Type of Construction	R.C.C. Framed Structure
7	Type of Foundation	R.C.C. Footing
8	Thickness of the External Walls	9" thick brick walls both sides plastered
9	Type of Compound	Brick Masonry Walls
10	Year of Construction	1999 (As per Possession Letter)
11	Present age of building	26 years
12	Residual age of the building	34 years Subject to proper, preventive periodic maintenance & structural repairs
13	No. of flats (Per Floor)	2nd Floor is having 4 Flats
14	Methodology adopted	As per visual site inspection

B.	External Observation of the Building	
1	Plaster	Normal Condition
2	Chajjas	Normal Condition
3	Plumbing	Normal Condition



Our Pan India Presence at :

- Nanded
- Thane
- Ahmedabad
- Delhi NCR
- Mumbai
- Nashik
- Rajkot
- Raipur
- Aurangabad
- Pune
- Indore
- Jaipur

Regd. Office

B1-001, U/B Floor, BOOMERANG, Chandivali Farm Road, Powai, Andheri East, **Mumbai**: 400072, (M.S), India

+91 2247495919

mumbai@vastukala.co.in

www.vastukala.co.in

4	Cracks on the external walls	Minor Found
5	Filling cracks on the external walls	Found
6	Cracks on columns & beams	Not Found
7	Vegetation	Not Found
8	Leakages of water in the drainage pipes or water pipes	Not Found
9	Dampness external in the wall due to leakages	Not Found
10	Any other observation about the condition of external side of the building	<ol style="list-style-type: none"> 1. At the time of site inspection, external condition of the building is normal. 2. Structural Stability Report from licensed structural engineers not provided for our verification.

C	Internal Observation of the common areas of the building and captioned premises	
1	Beams (Cracks & Leakages)	Good Condition
2	Columns (Cracks & Leakages)	Good Condition
3	Ceiling (Cracks & Leakages)	Good Condition
4	Leakages inside the property	Good Condition
5	Painting inside the property	Normal Condition
6	Maintenance of staircase & cracks	Normal Condition

D	Common Observation	
1	Structural Audit of the Building Under Bye – Laws No. 77 of the Model Bye Laws (Co-Operative Societies Act / Rules)	As per bye Laws No. 77 of Co-Op. Societies bye Laws under the Act the society shall conduct a Structural Audit of the building of the society as follows
2	Remark	No Structural Audit Report is furnished for the perusal.

E	Conclusion
<p>The captioned building is having Ground + 7 Upper Floors which are constructed in year 1999 (As per Possession Letter). Estimated future life under present circumstances is about 34 years subject to proper, preventive periodic maintenance & structural repairs.</p> <p>The inspection dated 24.02.2025 reveals no structural damage or deterioration to the building. The building is well as the property is maintained in normal condition & will stand future life subject to proper, preventive periodic maintenance & Good structural repairs.</p> <p>Our Observations about the structure are given above.</p> <p>The above assessment is based on visual inspection only. Separate structural audit from licensed structural engineers is advised to assess exact balance life of structure.</p>	

For VASTUKALA CONSULTANTS (I) PVT. LTD.

**Manoj
Chalikwar**
Director

Digitally signed by Manoj Chalikwar
DN: cn=Manoj Chalikwar, o=Vastukala
Consultants (I) Pvt. Ltd., ou=Mumbai,
email=manoj@vastukala.org, c=IN
Date: 2025.03.01 14:48:03 +05'30'

Auth. Sign.

Manoj Chalikwar
Govt. Reg. Valuer
Chartered Engineer (India)
Reg. No. IBBI/RV/07/2018/10366
State Bank of India Empanelment No.: SME/TCC/38/IBBI/3




Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company



Actual Site Photographs

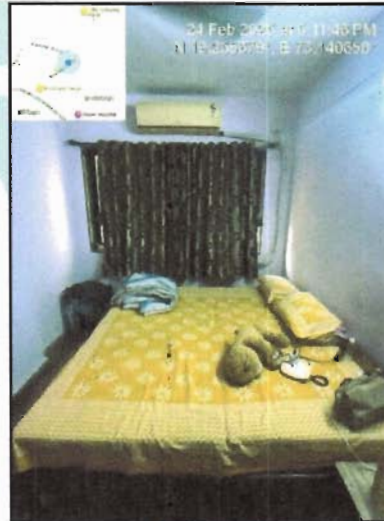

Since 1989

Vastukala Consultants (I) Pvt. Ltd.

An ISO 9001 : 2015 Certified Company

